

EXHIBIT 2 - VILLAGE OF FAIRPORT HARBOR
LCDU QUESTIONNAIRE RESULTS



SANITARY MANHOLE

SANITARY SEWER PIPE

PILOT AREA

YARD FLOODING


STREET FLOODING

BASEMENT FLOODING


LCDU - FAIRPORT HARBOR - I/I INVESTIGATION

0 100 200 400 600
Feet

BURGESS & NIPLE

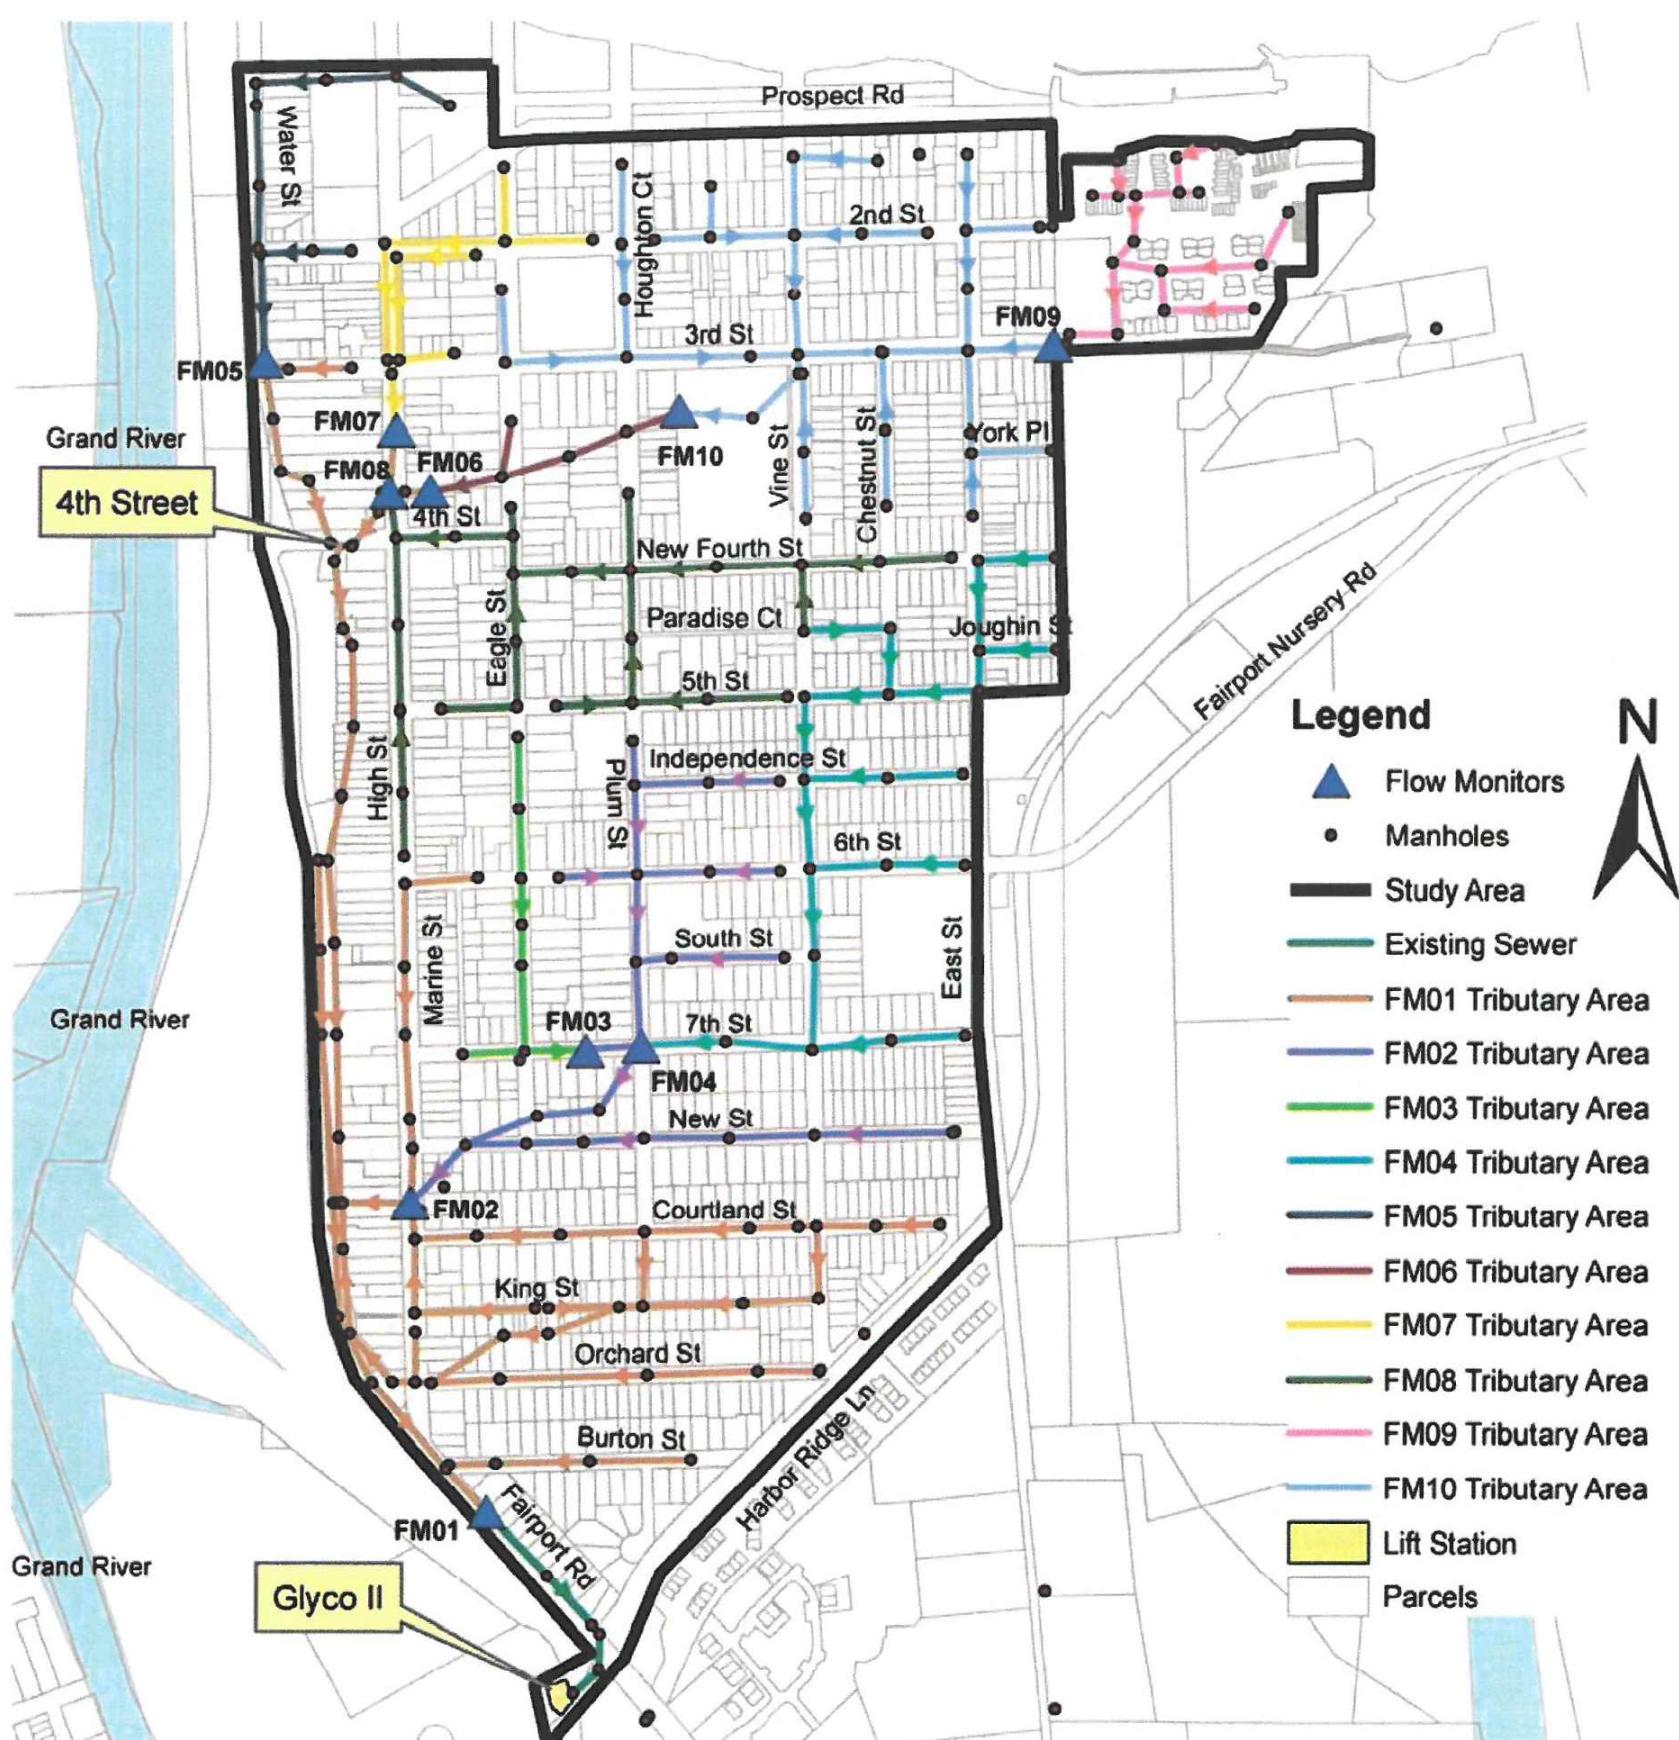

Rank	Individual Flow Monitor	Calculated Individual Peak I/I (gpd)	Individual Basin Ave. DWF (gpd)	Peaking Factor
1	FM08	1,693,286	45,210	37.5
2	FM10	2,022,603	78,078	25.9
3	FM06	1,053,230	67,103	15.7
4	FM07	605,190	41,094	14.7
5	FM04	880,238	62,457	14.1
6	FM02	612,929	58,169	10.5
7	FM03	325,611	32,134	10.1
8	FM09	121,111	12,540	9.7
9	FM01	1,425,794	308,503	4.6
10	FM05	178,833	68,731	2.6

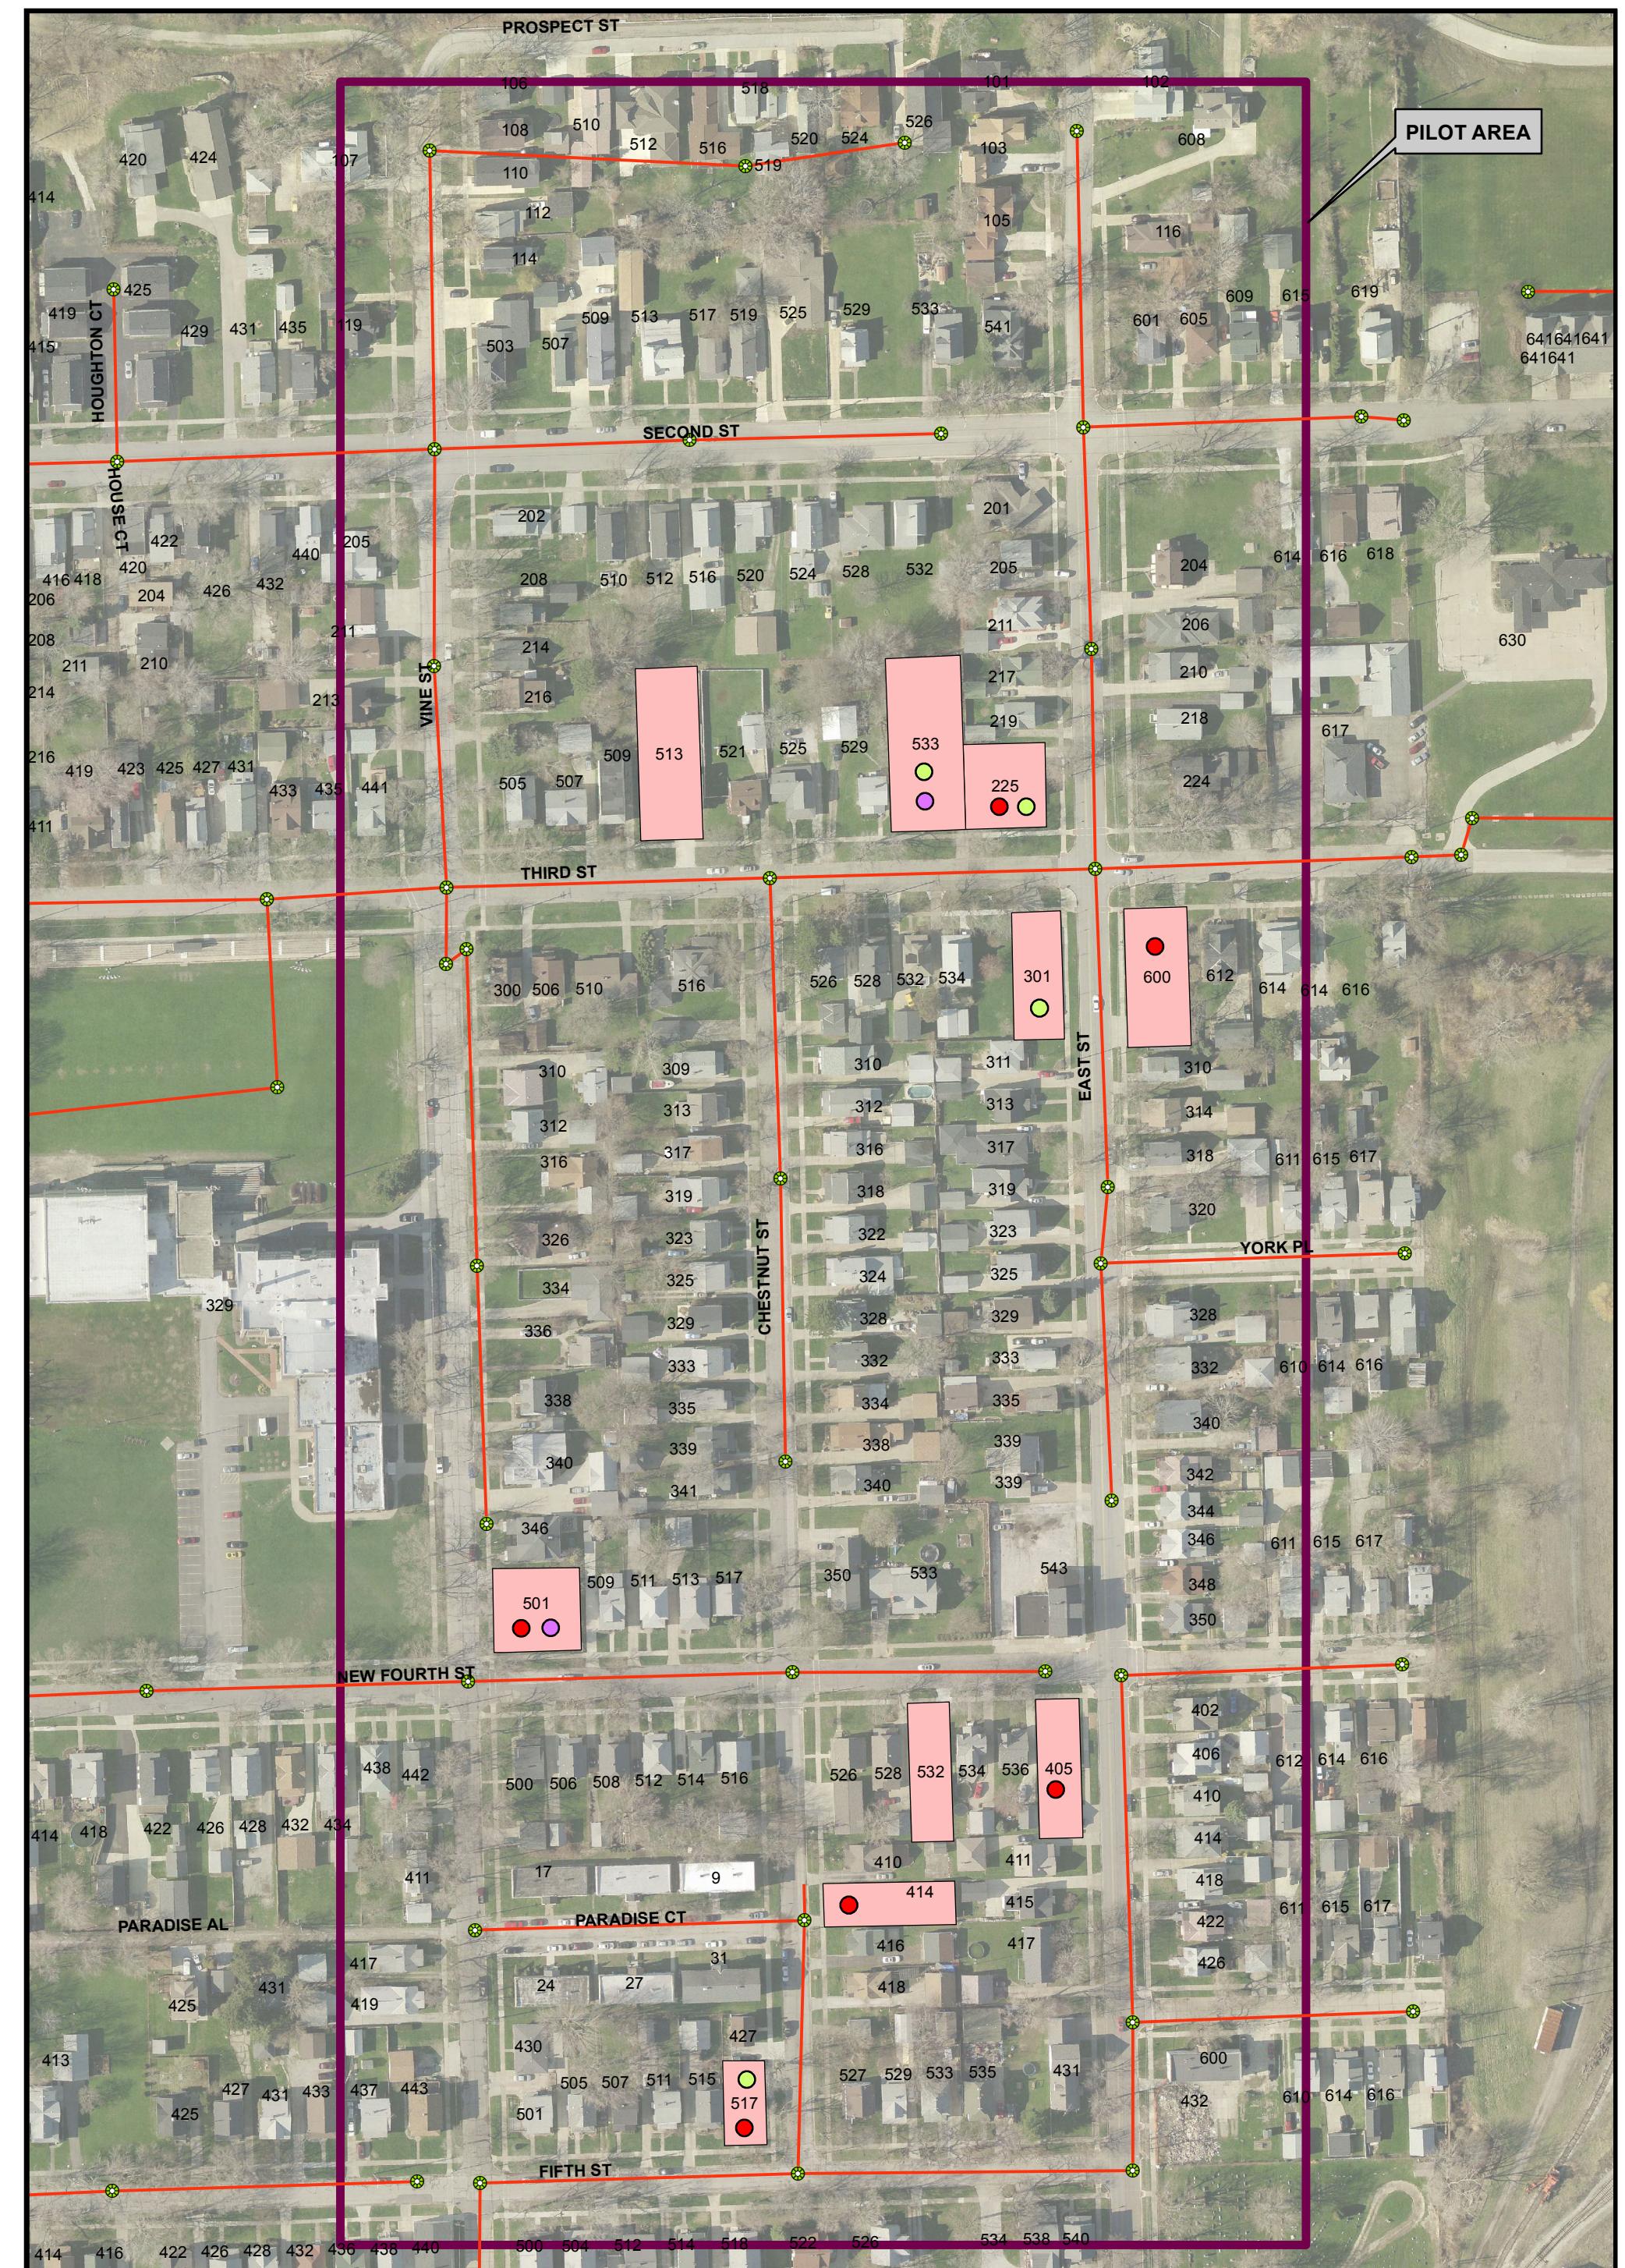

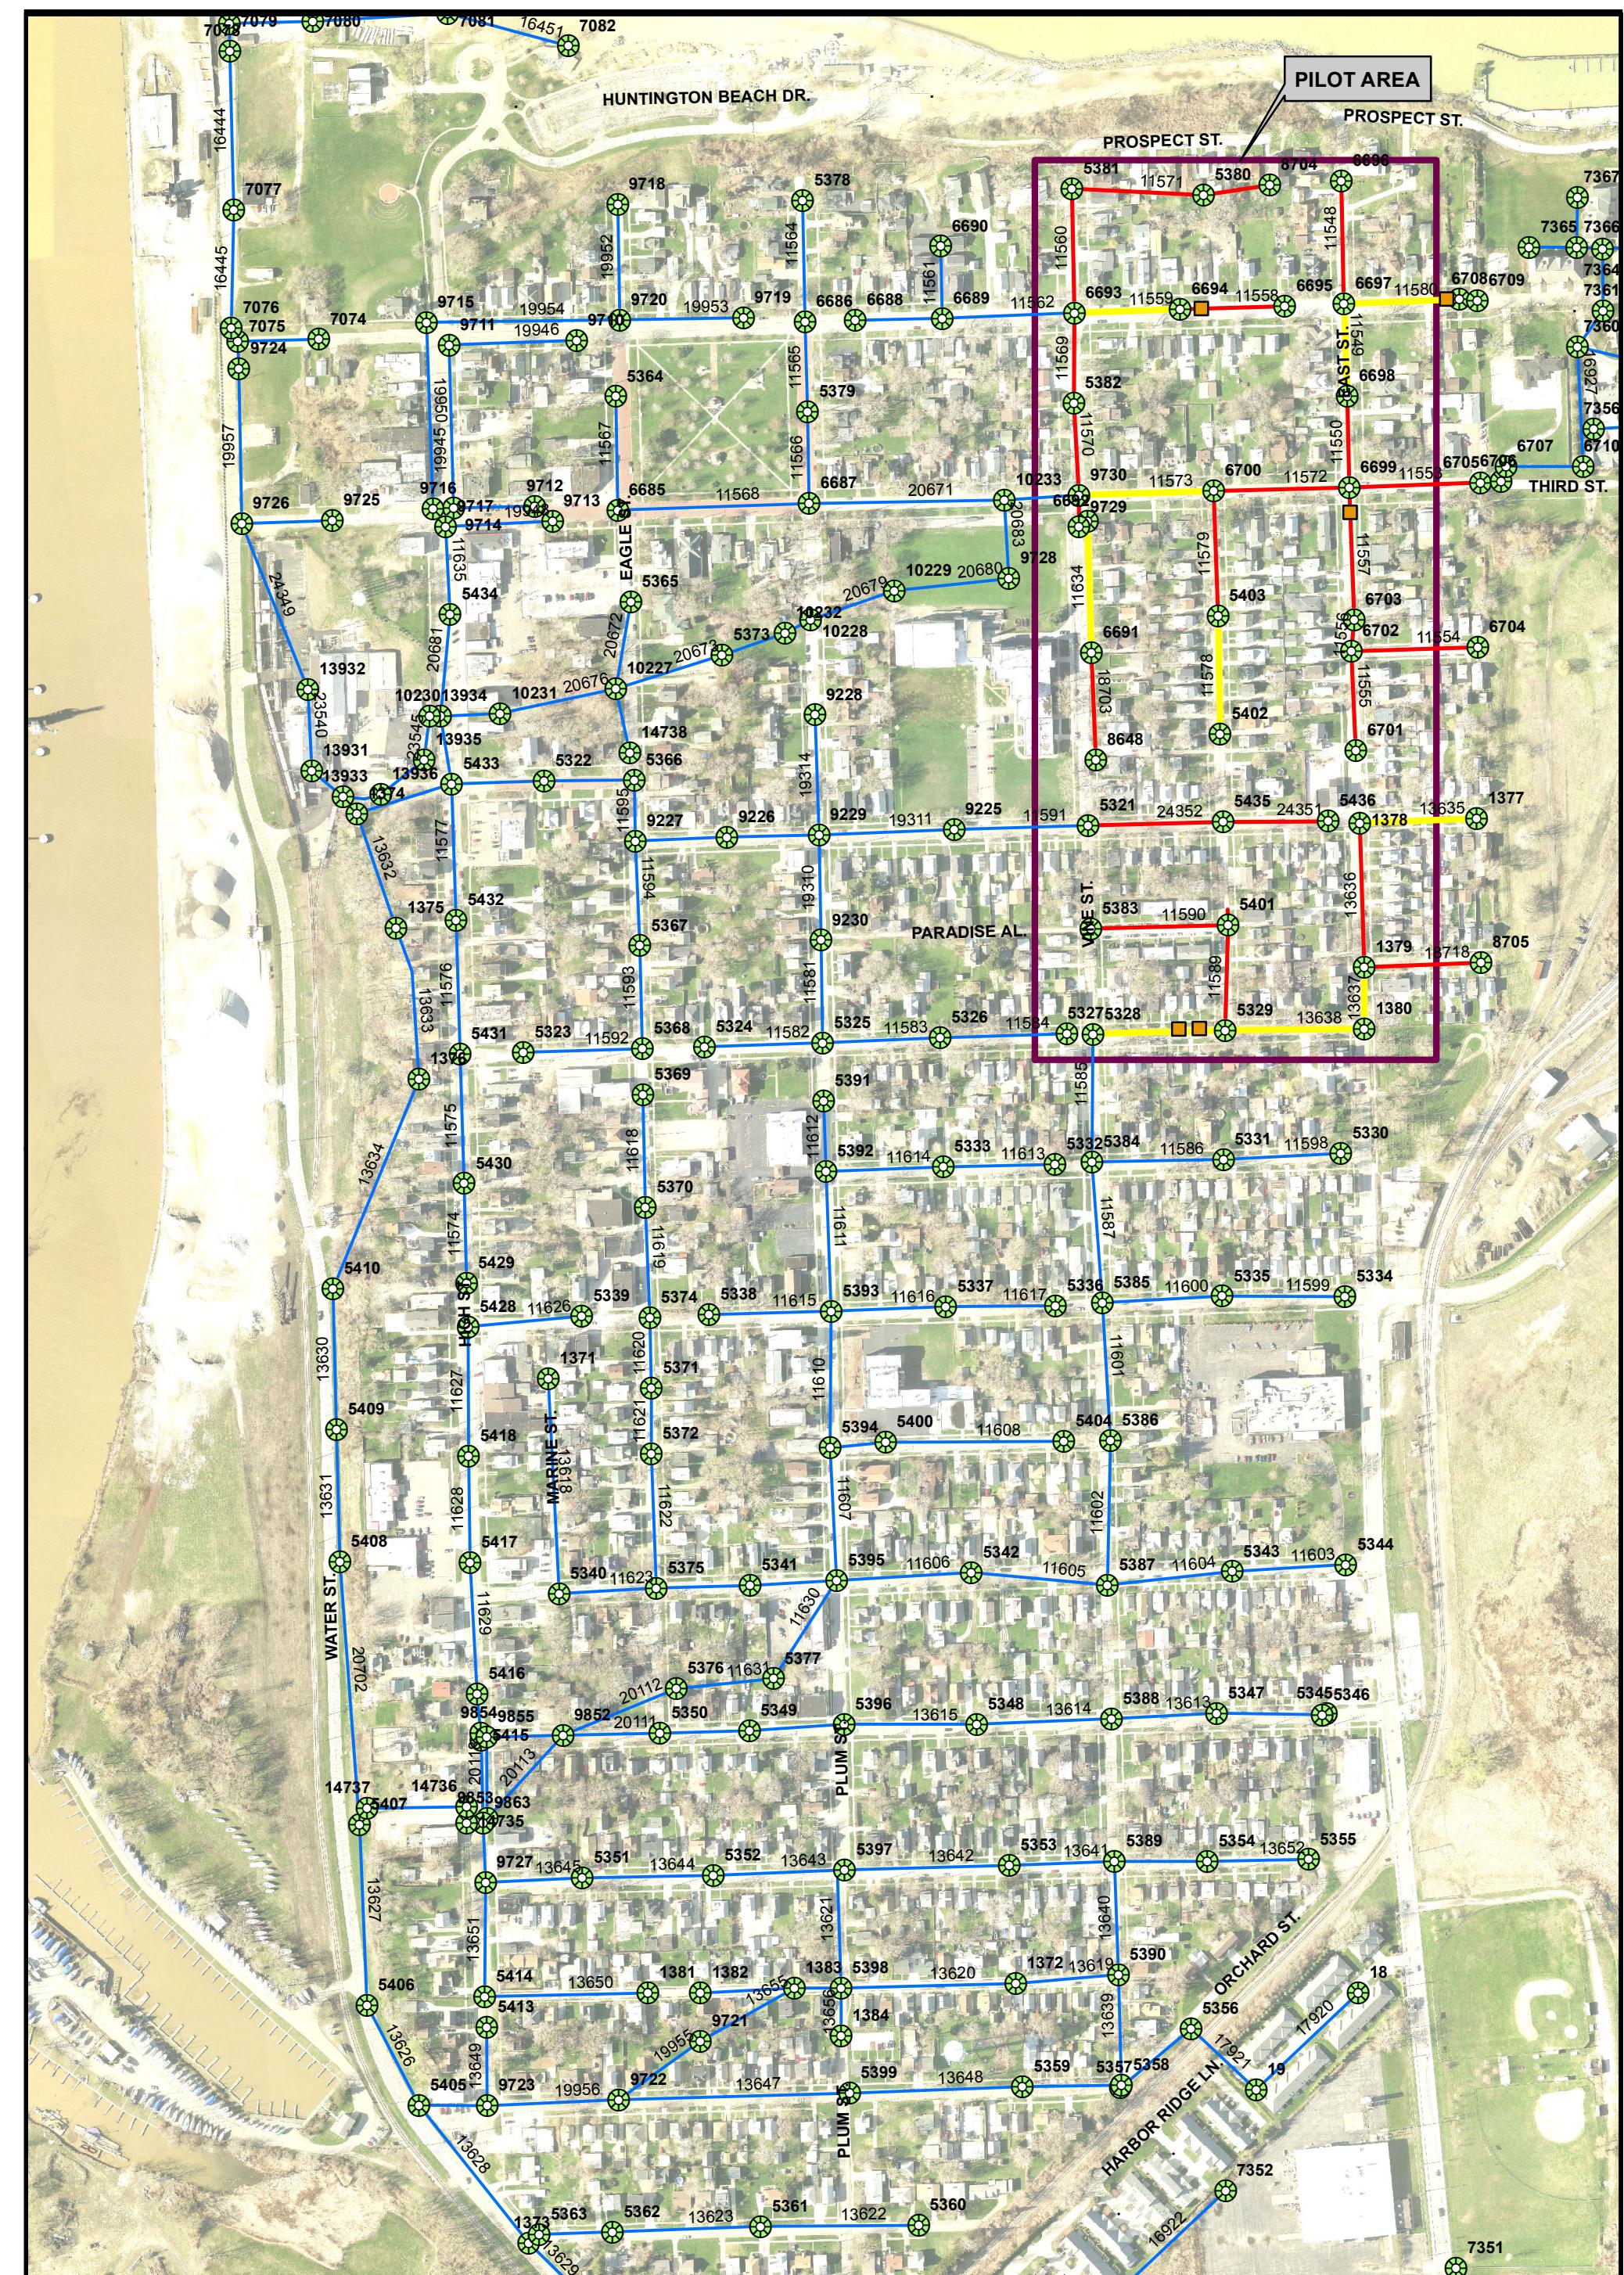


EXHIBIT 5 - VILLAGE OF FAIRPORT HARBOR
SANITARY SEWER SYSTEM
RECOMMENDED REPAIRS



- SANITARY MANHOLE
- SANITARY SEWER REVIEWED
- SANITARY SEWER OUTSIDE PILOT AREA
- SANITARY SEWER LINING RECOMMENDED

LCDU - FAIRPORT HARBOR - SEWER I/I INVESTIGATION

- PILOT AREA
- SANITARY SEWER POINT REPAIR

0 70 140 280 420 Feet

BURGESS & NIPLE

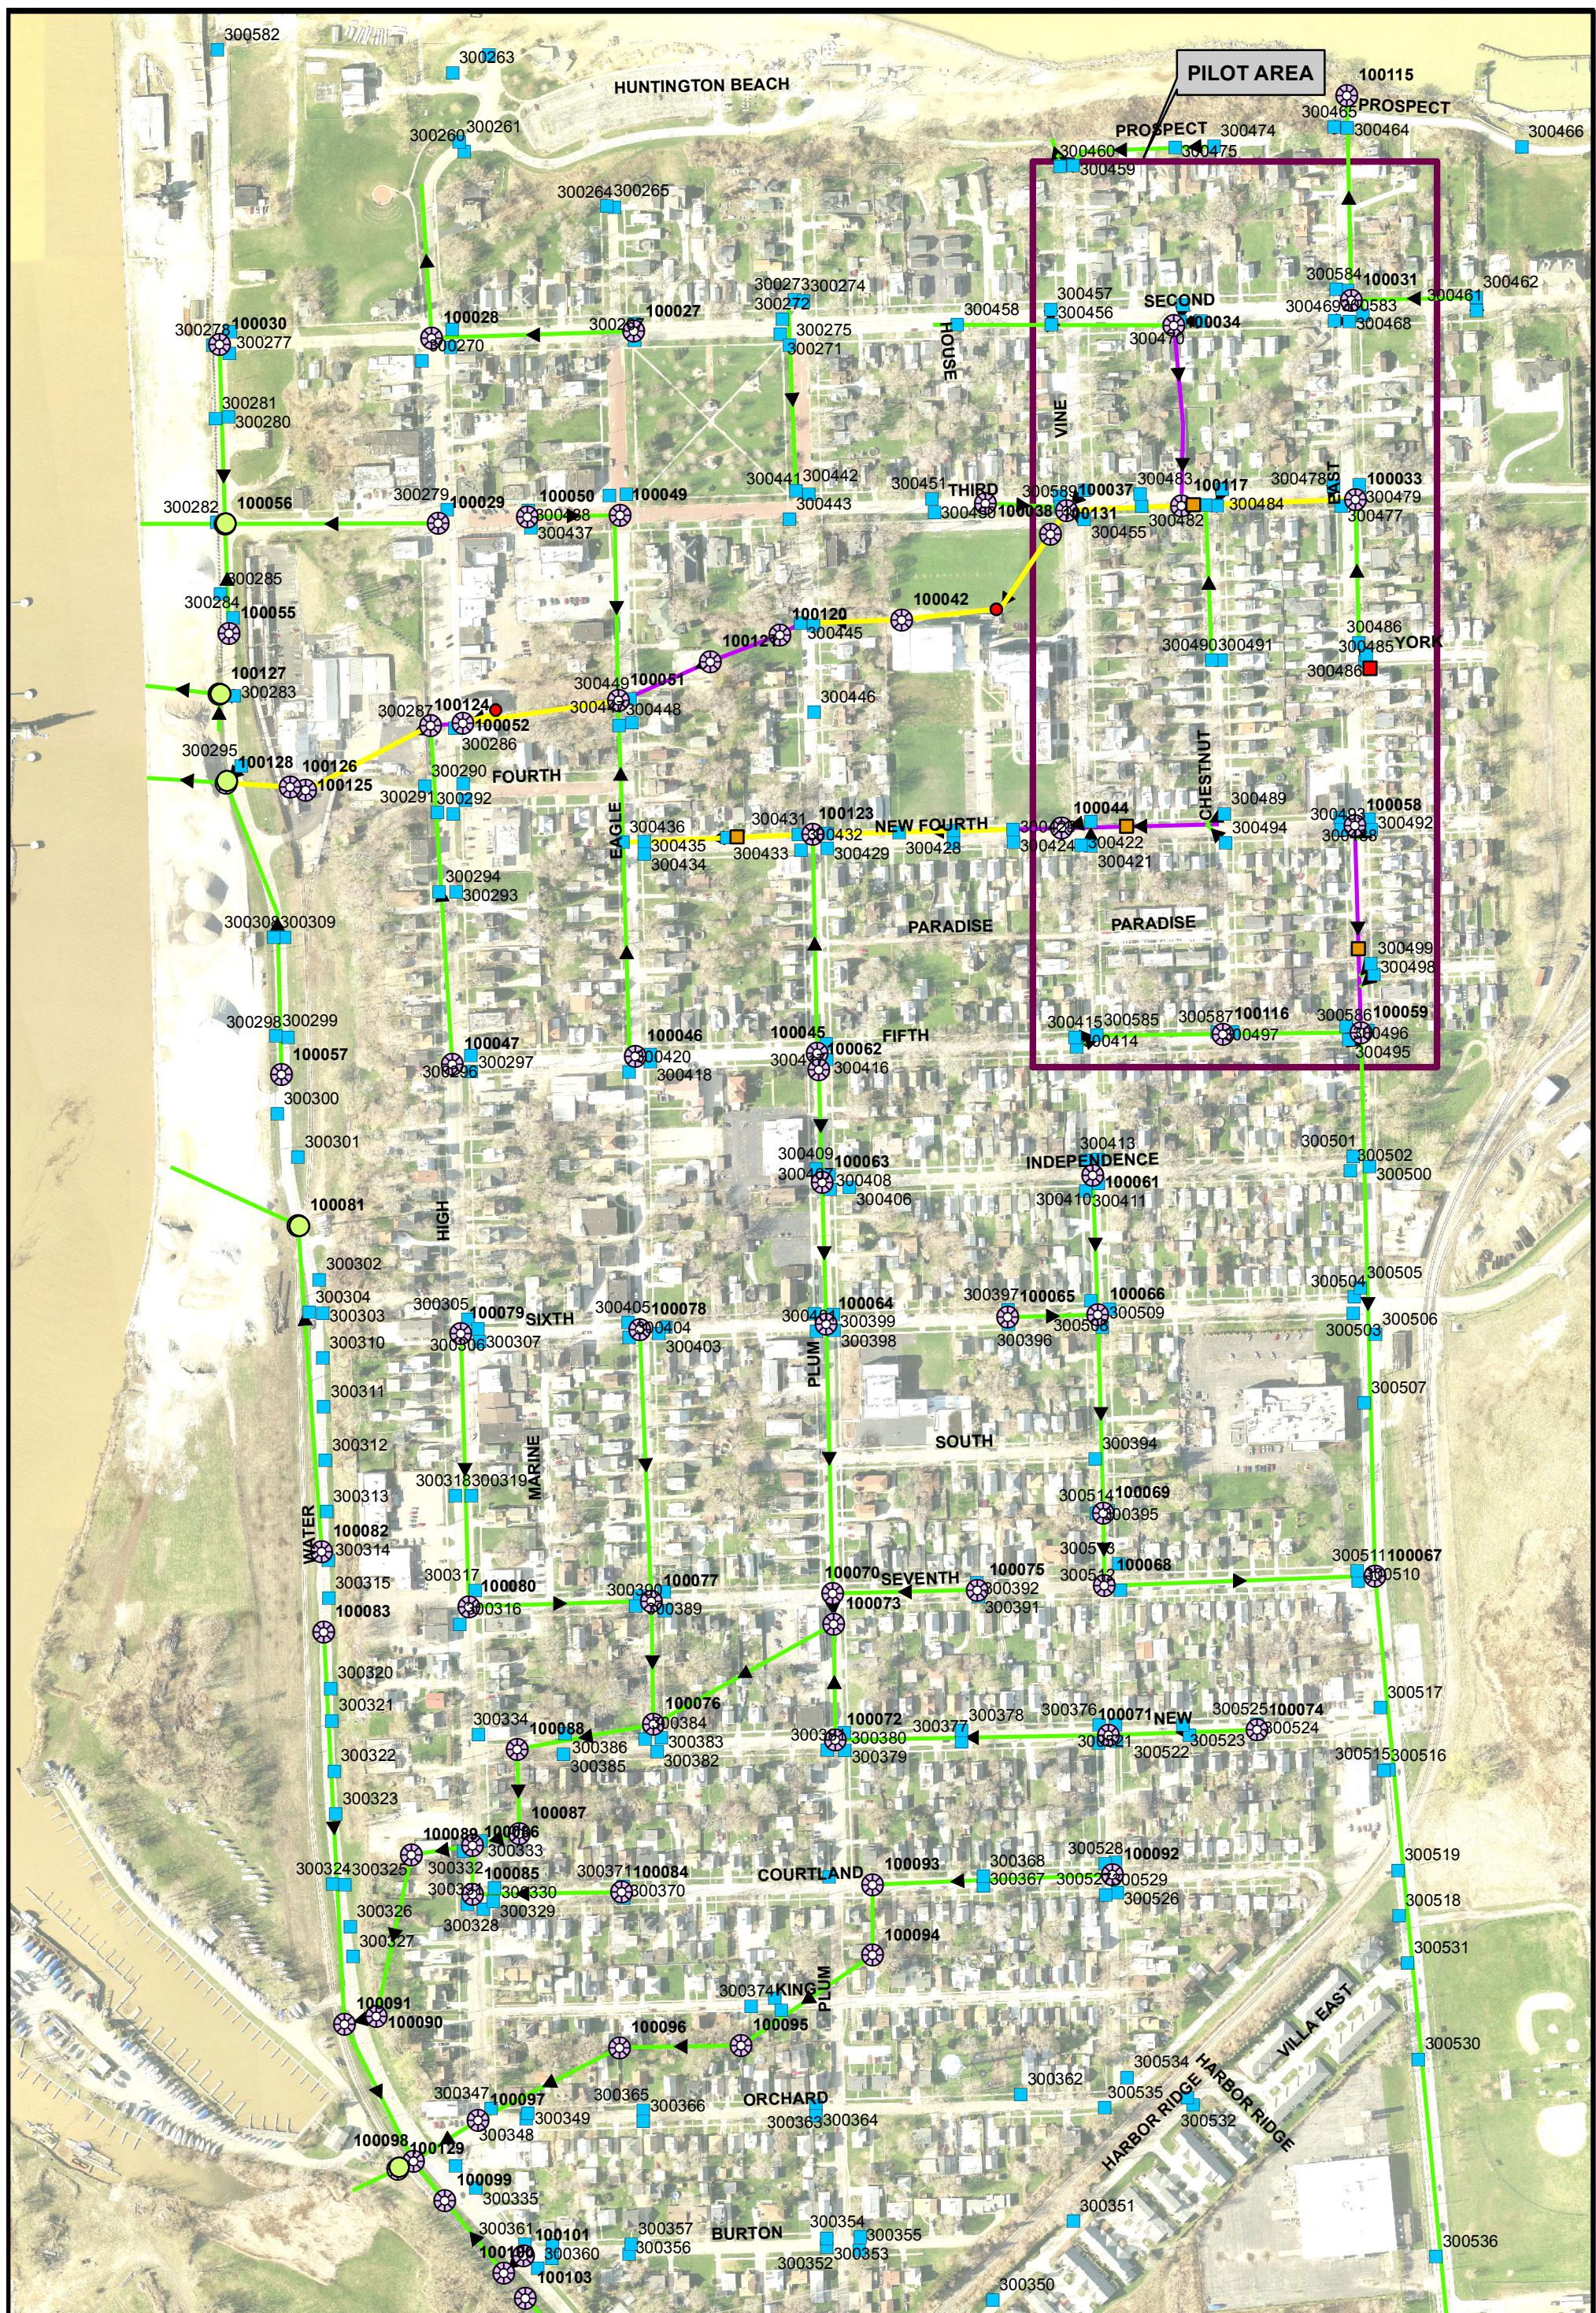


EXHIBIT 6 - VILLAGE OF FAIRPORT HARBOR
STORM SEWER SYSTEM
RECOMMENDED REPAIRS



- STORM MANHOLE, STORM CATCH BASIN
- STORM SEWER REVIEWED AS PART OF INVESTIGATION
- STORM SEWER OUTSIDE STUDY AREA
- STORM SEWER LINING OR REPLACEMENT
- STORM SEWER POINT REPAIR
- CATCH BASIN REHAB


LCDU - FAIRPORT HARBOR - SEWER I/I INVESTIGATION

0 105 210 420 630
Feet

PILOT AREA

NEW MANHOLE

BURGESS & NIPPLE

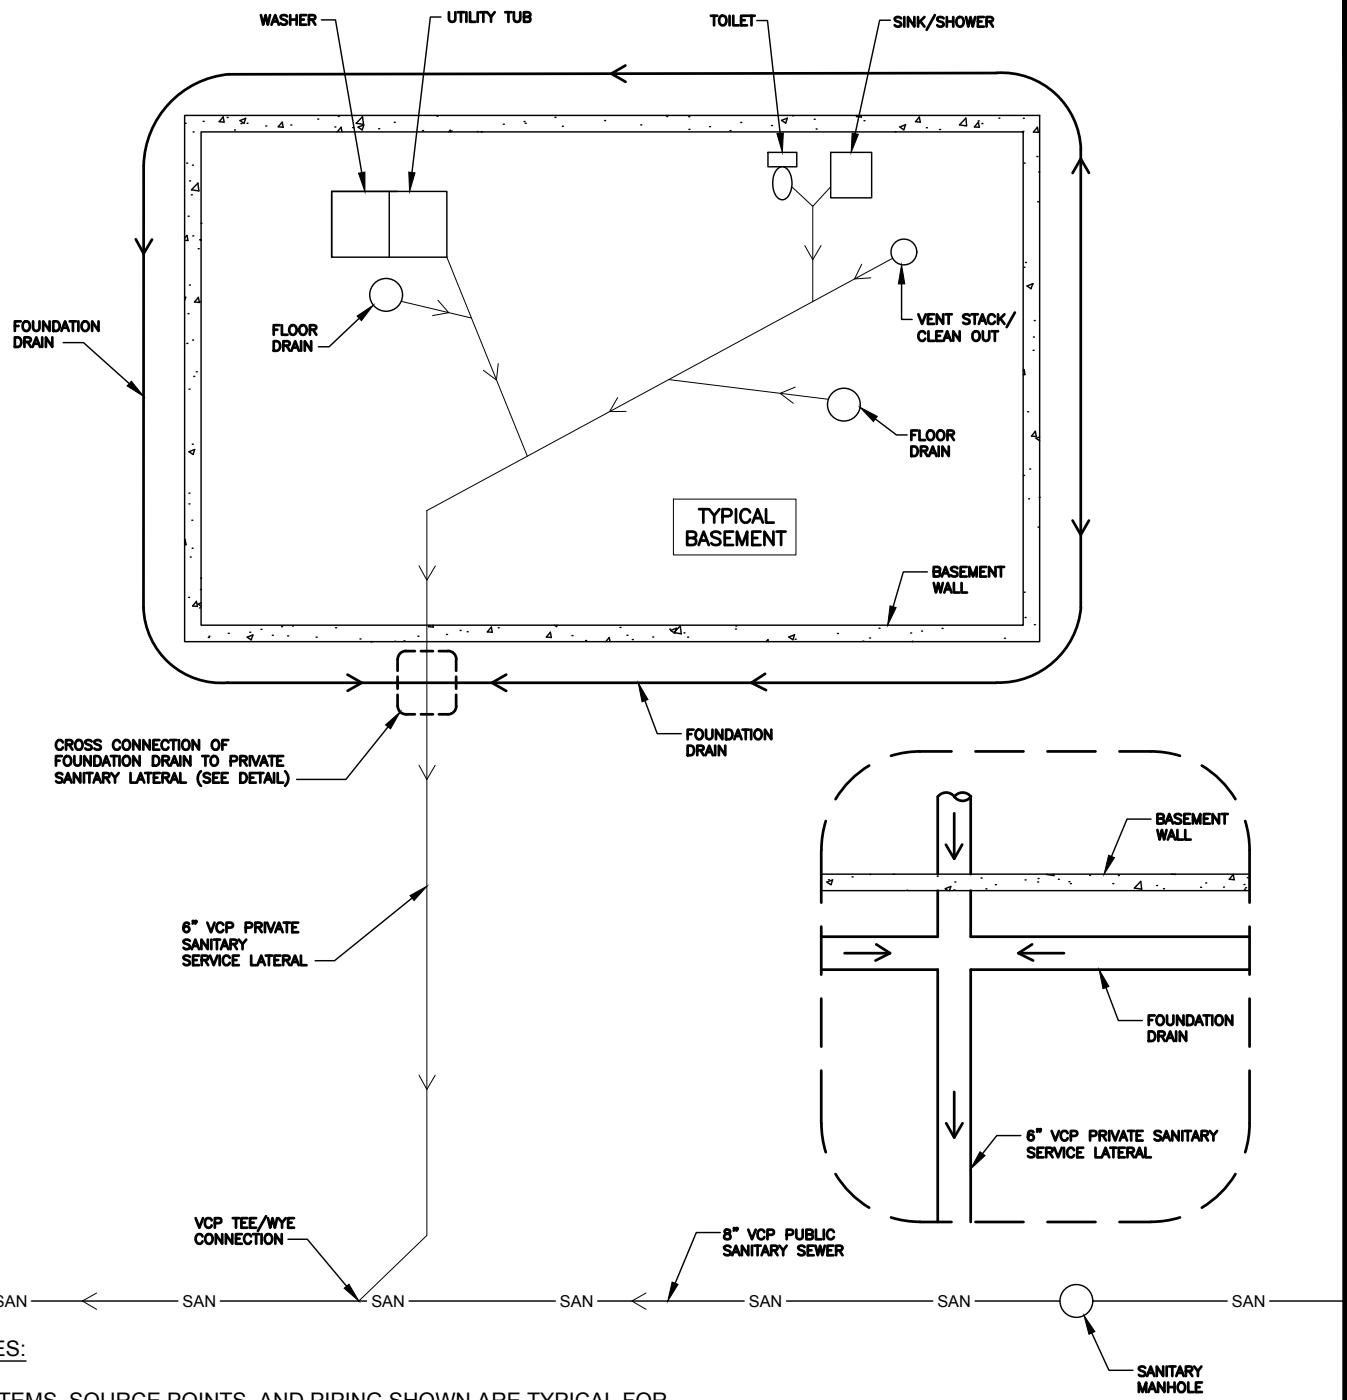NOTES:

1. ITEMS, SOURCE POINTS, AND PIPING SHOWN ARE TYPICAL FOR BASEMENTS OBSERVED. ACTUAL CONDITIONS AND CONFIGURATIONS WILL VARY FROM HOUSE TO HOUSE.
2. THE ONLY CLEAN-OUTS OBSERVED WERE LOCATED ON VENT STACKS. NO OUTSIDE CLEAN-OUTS WERE DETECTED DURING PRIVATE SANITARY LATERAL INSPECTION.
3. TYPICAL DOWNSPOUTS DISCHARGED TO SPLASH BLOCKS OR PIPED TO SIDEWALK/TREE LAWN. DURING TESTING TWO HOUSES WERE IDENTIFIED AS HAVING DOWNSPOUTS PREVIOUSLY TIED INTO THE PRIVATE SANITARY LATERAL.

SKETCH 1
TYP. BASEMENT PLUMBING

VILLAGE OF FAIRPORT HARBOR
LCDU - SEWER I/I INVESTIGATION

BURGESS & NIPLE, INC.